

Nihon Philips Corporation

Tokyo
Japan

Kopu. H.H. Wassenaar ✓
Rajstake
Schell
v Kemnade



return Mr. Reids perstaud

PHILIPS

N.V. Philips' Gloeilampenfabrieken
Eindhoven, The Netherlands

P.O. Box 13, World Trade Center
Hamamatsu-cho, Minato-ku, Tokyo.

Attn: Mr. E.K. Modderman/Elcoma BA

our ref KT/003/4

subject

Tel. Tokyo (03) 435-5211
Osaka (06) 231-7871

date 10 January, 1977

Re Iwatsu Claim Report

Dear Mr. Modderman,

As already have sent telexes, we will enclose here the report on rejected C.R.T. Questionnaire W-223 for 9 pcs which we would like to have your analysis of the tubes.

With best regards,

Yours faithfully,

P.O. NIHON PHILIPS CORPORATION

K. Taniguchi

Elcoma Division.

Kiyoshi Taniguchi

From Sales Organization	: Nihon Philips Corporation	
Type No.	: D13-500GH/01	
Invoice No.	: 540/0262.02	540/0254.02
Invoice Date	: 1976-10-29	1976-10-19
Defective Q'ty	: 6 pcs	4 pcs (*)
Tube No. ;	518969, 524499	546071, 524515
	518946, 618843	522913
	618841, 442923	
Order No. :	642-313, 345, 046	642-345

* 1 pce out of 4 pcs has been rejected on bubbles and has been returned to EHV. (W-222)

Indenter : Iwatsu Co., Limited.

540/0262.02..... 6 pcs

Tube No.

Reason for Rejection

1. 518969

*Adjustment of tube at approx. 8 μ A beam current and displaying sin wave. By shifting sine wave in X direction sine wave disappears from screen at approx. 2 divisions from right hand side (deshadow effect).(A)


*Too high cathode current for optimal focus setting.

2. 524499


*Oxydation of connecting pins

*Similar effect as indicated by item 1(A).

*Remarkable difference in focus quality between center and edge.

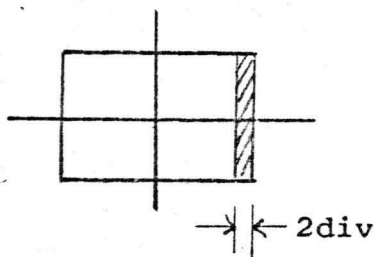


3. 518946

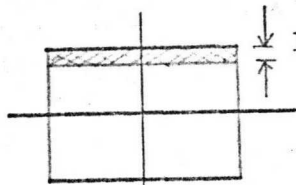

*Displacement of sine wave at a beam current level of 5 uA stop shift of sine wave in vertical direction. Top of sine waves disappear within useful display area particularly at right hand side.

4. 618843

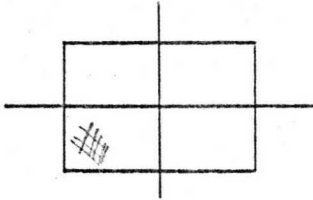


*Dust on mesh. Iwatsu has tried to remove dust from mesh. But did not succeed.

5. 618841

*Air leakage along pin connected to deflection plate. Metal cap on pin was loose.


6. 442923

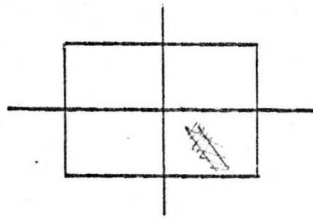

*Difference in brightness level between top and center of a displayed sine wave. At low brightness level displayed picture at top of display area disappears. Minor defect but not acceptable for Iwatsu.

540/0254.02..... 3 pcs

7. 546071

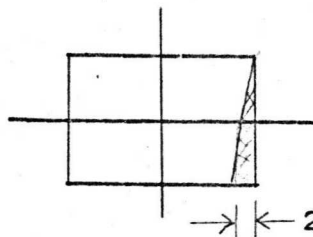

*Display of single vertical line. Shift of displayed vertical line in X direction to edge. Lower end of vertical line is bent 2 mm towards the center. Specification as agreed upon by EHV. is 1.2 mm.

8,9 524515

522913

*Serious oxydation of connecting pins. Iwatsu metal qual lab department recommends not to use these tubes in view of further deterioration. Visually rejected.

ZCZC YBA439 111320 PHE417 TK0366

RR NPHEBA LGR

249

+++

1976 1977-1-11

ELCOMA BA

MODDERMAN

CC: GRAAT-NPC

REF FURTHER REJECTS OF D13-500GH/01 BY IWATSU STOP

4 PCS OUT OF 10 PCS WERE REJECTED BY IWATSU VISUAL

INSPECTION BECAUSE OF SERIOUS OXYDATION OF CONNECTING

PINS STOP PLS RETEL IMM RETURN REFERENCE NUMBER

FOR 4 PCS REJECTS WITH FOLLOWING TUBE NRS AS

QUESTION NAIRE W-224 STOP

W-224 INVOICE NO. 540/0298.01

INVOICE DATE 30/11/76

DEFECTIVE Q'TY 4 PCS

TUBE NO. 618850, 606979, 524492, 522920

RGDS

TANIGUCHI NIHPHIL

111220

NNNN

9694-10151 - HVV - 7219-409

Kopie: HH, Wassenaar

Radstake

v. Kemnade

+ i. Hr. Deekers

Ar. Dengel

Ar. Mulder

Ar. Piper

Ar. Schell

N.V. Philips' Gloeilampenfabrieken
Centrale Telegraaf- en Telexafdeling

2822 100 88051

Kopu. HH. Redstake

Wassenaar ✓

L. Popen

H. Schell

ZCZC RBA433 130910 PHE578 TK0897
RR NPHEBA LGR

249

+++

4743 1976-12-13

ELCOMA BA

MODDERMAN/DENGEL

CC: MULDER ELCOMA BA

DEKKERS ELCOMA BAE

ITAKURA/OVERDIJK NPC

RE PHONE CALL DEC. 10 ON REJECTS OF D13-500GH BY IWATSU

REPLACED QUANTITY : 23 PCS

A) 1 PC OUT OF 23 PCS HAS BEEN REJECTED ON BUBBLES STOP
SAMPLE HAS BEEN RETURNED TO EHV.

B) TUBE NO. 522913 AND 524515

COMPLAINT: SERIOUS OXYDATION OF CONNECTING PINS STOP
IWATSU METAL QUAL LAB DEPARTMENT RECOMMENDS NOT TO USE
THESE TUBES IN VIEW OF FURTHER DETERIORATION STOP
VISUALLY REJECTED

C) TUBE NO. 611841

AIR LEAKAGE ALONG PIN CONNECTED TO DEFLECTION PLATE STOP
METAL CAP ON PIN WAS LOOSE

D) TUBE NO. 518969

1) ADJUSTMENT OF TUBE AT APPROX. 8 UA BEAM CURRENT AND

H DISPLAYING SINE WAVE STOP BY SHIFTING SINE WAVE IN X

N.V. Philips' Gloeilampenfabrieken
Centrale Telegraaf- en Telexafdeling

2822 100 88051

DIRECTION SINE WAVE DISAPPEARS FROM SCREEN AT APPROX.
2 DIVISIONS FROM RIGHT HAND SIDE (DESHADOW EFFECT)

2) TOO HIGH CATHODE CURRENT FOR OPTIMAL FOCUS SETTING

E) TUBE NO. 524499

1) OXYDATION OF CONNECTING PINS

2) SIMILAR EFFECT AS INDICATED BY ITEM D1

3) REMARKABLE DIFFERENCE IN FOCUS QUALITY BETWEEN CENTER
AND EDGE

F) TUBE NO. 518946

DISPLACEMENT OF SINE WAVE AT A BEAM CURRENT LEVEL OF
5 UA STOP SHIFT OF SINE WAVE IN VERTICAL DIRECTION
STOP TOPS OF SINE WAVES DISAPPEAR WITHIN USEFUL DISPLAY
AREA PARTICULARLY AT RIGHT HAND SIDE

G) TUBE NO. 618843

DUST ON MESH STOP IWATSU HAS TRIED TO REMOVE DUST FROM
MESH BUT DID NOT SUCCEED STOP

H) TUBE NO. 442923

DIFFERENCE IN BRIGHTNESS LEVEL BETWEEN TOP AND CENTER
OF A DISPLAYED SINE WAVE STOP AT LOWBRIGHTNESS LEVEL DISPLAYED PICTURE AT TOP OF DISPLAY
AREA DISAPPEARS STOP MINOR DEFFECT BUT NOT ACCEPTABLE FOR
IWATSU

I) TUBE NO. 546071

DISPLAY OF SINGLE VERTICAL LINE STOP STOP SHIFT OF
DISPLAYED VERTICAL LINE IN X DIRECTION TO EDGE STOPN.V. Philips' Gloeilampenfabrieken
Centrale Telegraaf- en Telexafdeling

2822 100 88051

Nihon Philips Corporation

Tokyo
Japan

Kopia: H.H. Wassenaar ✓
Schell
Radstake
v. Kemmerde



PHILIPS

N.V. Philips' Gloeilampenfabrieken
Eindhoven, The Netherlands

Shuwa-Shinagawa Bldg. 7,8th Fl.
26-33, Takanawa 3-chome,
Minato-ku, Tokyo, 108 Japan

Attn: Mr. E.K. Modderman/ Elcoma BA

our ref KT/mt/036/4

subject

Tel. Tokyo (03) 446-5611
Osaka (06) 231-7871

date 15 November, 1976

Re Iwatsu Claim Report

Dear Mr. Modderman,

We will enclose here the report on rejected C.R.T. Questionaire W-222 for 1 pce which we would like to have your analysis of the tube.

We will highly appreciate your information of reference number for return shipment.

With best regards,

Yours faithfully,

P.O. NIHON PHILIPS CORPORATION

K. Taniguchi
Elcoma Division.

K. Taniguchi

Report on Rejected C.R.T. W-222

From Sales Organization : Nihon Philips Corporation.
Type No. : D13-500GH/01
Invoice No. : 540/0254.02
Invoice Date. : 20/10/76
Defective Quantity : 1 pce
Order Nr. : 642-345
Indenter : Iwatsu Co., Limited

Tube Nr.

Reason for rejection

514971

bubbles

Nihon Philips Corporation

Tokyo
Japan

Kopie: H.A. Wassenaar
Radstake
Schell
v. K... ..



Retourner. naar de afzender.

PHILIPS

N.V. Philips' Gloeilampenfabrieken
Eindhoven, The Netherlands

Shuwa-Shinagawa Bldg. 7,8th Fl.
26-33, Takanawa 3-chome,
Minato-ku, Tokyo, 108 Japan

Attn: Mr. Modderman/ Elcoma BAE

our ref KT/022/4

Date: 01/06/76

subject

Tel. Tokyo (03) 448-5611
Osaka (06) 231-7871

date 27 June, 1976

Re Iwatsu Claim Report

Dear Mr. Modderman,

We will enclose here the reports on rejected C.R.T. Questionaire W-220 for 13 pcs which we would like to have your analysis of the tubes.

We will highly appreciate your information of reference number for return shipment.

With best regards,

Yours faithfully,

P.O. NIHON PHILIPS CORPORATION

K. Taniguchi

Elcoma Div.

K. Taniguchi

Report on rejected C.R.T. W-220

From Sales Organization : Nihon Philips Corporation
Type No. : D13-500GH/01
Invoice No. : 540/0133.03
Invoice Date. : 01/06/76
Defective Quantity : 13 pcs
Indenter : Iwatsu Co., Limited

<u>Tube No.</u>	<u>Reason for rejection</u>
618846, 606973, 618841, 605134, 618854, 606975, 618848, 618855, 618849, 618843, 618852, 618844, 609602,	too many bubbles.



*Hr. v. Kennen,
Is hiervoor al retourne doorgegeven?*

PHILIPS

N.V. Philips' Gloeilampenfabrieken
Eindhoven, The Netherlands

P.O. Box 13, World Trade Center
Hamamatsu-cho, Minato-ku, Tokyo.

Attn: Mr. Modderman/ Elcoma BA

our ref: KT/mt/018/4

subject

Tel. Tokyo (03)435-5211
Osaka (06)231-7871

date 1 June, 1976

Re; Iwatsu Claim Report

Dear Mr. Modderman,

We will enclose here the reports on Rejected C.R.T. Questionaire W-218 for 3 pcs and W-219 for 1 pce which we would like to have your analysis of the tubes.

We will highly appreciate your information of reference number for return shipment.

With best regards,

Yours faithfully,

p.o. NIHON PHILIPS CORPORATION

K. Taniguchi

Elcoma Div.

K. Taniguchi

Report on Rejected C.R.T. W-218

From Sales Organization : Nihon Philips Corporation
Type No. : D13-500GH/01
Invoice No. : 540/0087.01
Invoice Date : 13/04/76
Defective Quantity : 3 pcs
Indenter : Iwatsu Co., Limited

<u>Tube No.</u>	<u>Reason for rejection</u>
524513	* blur at right side screen (on the lower part, -2 div from center, markedly) * obscure focus * s.p halation
522768	* blur at the sides of the screen * bubbles on the screen * bright line is blurred on the upper part of the screen * s.p halation
524492	* distortion of pattern is big (1.2 - 1.3mm in the Y-direction of the right of the screen) * bubbles on the lower part of the screen

Report on rejected C.R.T W-219

From Sales Organization : Nihon Philips Corporation.
Type No. : D10-200GH/07
Invoice No. : 540/0096.02
Invoice Date : 23/04/76
Defective Quantity : 1 pce
Indenter : Iwatsu Co., Limited

Tube No.

Reason for rejection

043709

* the difference in brightness and disappearance of tested waveform when focus electrode voltage is changed

* vertical linearty 2.5%

Mr. Wassenaar
Mr. Radstake
Mr. Wassenaar

Mr. v. Kempen, M
Mr. v. Kester, M

N.V. Philips' Gloeilampenfabrieken
Centrale Telegraaf- en Telexafdeling

249
+++
3636 1976-05-25
ELCOMA BA
MODDERMAN
CC: GRAAT-NPC

1. WILL REPORT ON REJECTED CRT QUESTIONAIRE FOR W-218 FOR 3
PCS WOULD LIKE TO HAVE YR ANALYSIS ON THE TUBES
APPRECIATE YR INFO OF REFERENCE NUMBER FOR RETURN SHIPMENT.
REPORT ON REJECTED C.R.T. W-218

FROM SALES ORGANIZATION : NIHON PHILIPS CORP.
TYPE NO : D13-500GH/01
INVOICE NO. : 540/0087.01
INVOICE DATE : 13/04/76
DEFECTIVE QUANTITY : 3 PCS
INDENTER : IWATSU CO., LIMITED
TUBE NO. REASON FOR REJECTION

524513 + BLUR AT RIGHT SIDE SCREEN(ON HE LOWER PART
(-2 DIV FROM CENTER,) MARKEDLY)
+ OBSCURE FOCUS
+ S.P HALATION

TELEGRAM - TELEXBERICHT

0043049

522768 + BLUR AT THE SIDES OF THE SCREEN
+ BUBBLES ON THE SCREEN
+ BRIGHT LINE IS BLURRED ON THE UPPER PART
OF THE SCREEN
+ S.P HALATION
524492 + DISTORTION OF PATTERN IS BIG (1.2-1.3MM IN THE Y-
DIRECTION OF THE RIGHT OF THE SCREEN.)
+ BUBBLES ON THE LOWER PART OF THE SCREEN

2. ALSO WILL REPORT ON REJECTED C.R.T QUESTIONAIRE FOR W-219
FOR 1 PCE WOULD LIKE TO HAVE YR ANALYSIS ON THE TUBE
APPRECIATE YR INFO OF REFERENCE NUMBER FOR RETURN
SHIPMENT.

REPORT ON REJECTED C.R.T W-219

FROM SALES ORGANIZATION : NIHON PHILIPS CORP.
TYPE NO : D10-200GH/07
INVOICE NO. : 540/0096.02
INVOICE DATE : 23/04/76
DEFECTIVE QUANTITY : 1 PCE
INDENTER : IWATSU CO., LIMITED
TUBE NO. REASON FOR REJECTION

043709 + THE DIFFERENCE IN BRIGHTNESS AND DISAPPEARANCE
OF TESTED WAVEFORM WHEN FOCUS ELECTRODE
VOLTAGE IS CHANGED

TELEGRAM - TELEXBERICHT

0043050

+ VERTICAL LINEARTY 2.5-0/0

RGDS
TANIGUCHI NIHPHIL
251102

N.V. Philips' Gloeilampenfabrieken
Centrale Telegraaf- en Telexafdeling

2822 100 88051

2822 100 88051

TELEGRAM - TELEXBERICHT

0045409

ZCZC YBA196 060619 PHE889 TK0232
RR NPHEBA LGR
249
+++

*Kopi: Hr. v. Keunen
Hr. Wassenaar*

4671 1976-04-06

ELCOMA BF
MODDERMAN

CC: GRAAT NPC

WILL REPORT ON REJECTED CRT QUESTIONNAIRE FOR W-216 FOR 1 PCE
WOULD LIKE TO HAVE YR ANALYSIS TUBE.
APPRECIATE YR INFO OF REFERENCE NUMBER FOR RETURN SHIPMENT.
REPORT ON REJECTED C.R.T. W-216

FROM SALES ORGANIZATION: NIHON PHILIPS CORP.

TYPE NO: D13-500GH/01

ORDER NO: 440-532

INVOICE NO: 540/0009.02

INVOICE DATE : 20/1/76

DEFECTIVE QUANTITY: 1 PCE

INDENTER: IWATSU CO., LIMITED

TUBE NO REASON FOR REJECTION

524515 BLUR OF BRIGHT LINE
(AT LOWER PART ESPECIALLY.)

RGDS

N.V. Philips' Gloeilampenfabrieken
Centrale Telegraaf- en Telexafdeling

2822 100 88051

TELEGRAM - TELEXBERICHT

0045410

TANIGUCHI NIHPHIL
060513
NNNN

Hr. v. K.

Wilt u retourne doorgeven?

N.V. Philips' Gloeilampenfabrieken
Centrale Telegraaf- en Telexafdeling

2822 100 88051

Nihon Philips Corporation

Tokyo
Japan

Kopie: HH, v. Kemnade

*Wassenaar
Radschake*



Receiv. doorgegeven per telex van 6/4

PHILIPS

Schell

N.V. Philips' Gloeilampenfabrieken
Eindhoven, The Netherlands

P. O. Box 13, World Trade Center
Hamamatsu-cho, Minato-ku, Tokyo.

Attn: Mr. E.K. Modderman/ Elcoma BF

our ref KT/mt/013/4

subject

Tel. Tokyo (03) 435-5211
Osaka (06) 231-7871

date 6 April, 1976

Re: Report on Rejected C.R.T. for W-216

Dear Mr. Modderman,

We will enclose here the report on rejected C.R.T. Questionnaire W-216 for 1 pce which we would like to have your analysis of the tube.

We will highly appreciate your information of reference number for return shipment.

With best regards,

Yours faithfully,

P.O. NIHON PHILIPS CORPORATION

K. Taniguchi

Elcoma Div.

K. Taniguchi

cc: Mr. Holvast BAE

Report on rejected C. R. T.

Questionnaire NO.W-216

From Sales Organization : Nihon Philips Corporation
Type No. : D13-500GH/01
Indenter : Iwatsu Co., Limited
Order No. : 440-532
Invoice No. : 540/0009.02
Invoice Date. : 20/1/76
Defective Quantity : 1 pce

Tube No.

Reason for rejection

524515

blur of bright line (at lower part
especially)

Nihon Philips Corporation

*Needs per telex
aanpakendigheid.*

*Kopie: H11 v. Keménade
Wassenaar
Radschke
Schell*

Tokyo
Japan



PHILIPS

N.V. Philips' Gloeilampenfabrieken
Eindhoven, The Netherlands

P. O. Box 13, World Trade Center
Hamamatsu-cho, Minato-ku, Tokyo.

Attn: Mr. E.K. Modderman/ Elcoma BF

our ref KT/mt/O10/4

subject

Tel. Tokyo (03)435-5211
Osaka (06)231-7871

date 8 March, 1976

Re: Report on Rejected C.R.T for W-215

Dear Mr. Modderman,

We will enclose here the report on rejected C.R.T. Questionnaire W-215 for 1 pce which we would like to have your investigation on the tube.

We will highly appreciate your information of reference number for return shipment.

With best regards,

Yours faithfully,

P.O. NIHON PHILIPS CORPORATION

K. Taniguchi
Elcoma Div.

cc: Mr. Holvast/BAE

10000. 7. 05

Report on rejected C.R.T.

Questionnaire NO. W-215

From Sales Organization : Nihon Philips Corporation
Type No. : D13-500GH/01
Indenterer : Iwatsu Co., Limited
Order No. : 440-143
Invoice No. : 540/0216.1
Invoice Date : 28/10/75
Defective Quantity : 1 pce

Tube No.

Reason for Rejection

522762

bubbles massed together at the
lower part of the screen

Nihon Philips Corporation

Tokyo
Japan

Kopie : Hr. v. Kemnade
Hr. Wassenaar
Hr. Kadstake
Hr. Schell



Hr. v. Kemnade,
per telex reeds aangekondigd.
MP

PHILIPS

N.V. Philips' Gloeilampenfabrieken
Eindhoven, The Netherlands

P. O. Box 13, World Trade Center
Hamamatsu-cho, Minato-ku, Tokyo.

Attn: Mr. E.K. Modderman/ Elcoma BF

our ref KT/mt/007/4

subject

Tel. Tokyo (03) 435-5211
Osaka (06) 231-7871

date 10 February, 1976

Re: Report on Rejected .C.R.T. for W-214

Dear Mr. Modderman,

We will enclose here the report on rejected C.R.T. questionnaire W-214 for 1 pce which we would like to have your investigation on the tube.

We will highly appreciate your information of reference number for return shipment.

With best regards,

Yours faithfully,

p.o. NIHON PHILIPS CORPORATION

K. Taniguchi

K. Taniguchi

Elcoma Div.

Mr. Holvast/BF

Report on rejected C.R.T.

Questionnaire NO.W-214

From Sales Organization : Nihon Philips Corporation
Type No. : D13- 500GH/01
Indenterer : Iwatsu Co., Limited
Order No. : 440-532
Invoice No. : 540/0009.02
Invoice Date : 20/ 01/ 76
Defective Quantity : 1 pce

Tube No.

Reason for Rejection

524512

bubbles massed together on the
screen

TELEGRAM - TELEXBERICHT

0011317

Kopi: Hr. v. Kemenade
Hr. Radstake
Hr. Schell
Hr. Wassenaar

ZCZC YBA482 161441 PHE723 TK0140
RR NPHEBA LGR

249
+++
3063 1976-01-16

ELCOMA BF
MODDERMAN

RE REPORT ON REJECTED C.R.T D13-500GH /01 FOR W-212
WILL REPORT ON REJECTED C.R.T QUESTIONAIRE W-212 FOR 2 PCS
WHICH WE WOULD LIKE TO HAVE YR INVESTIGATION ON THE TUBES.
APPRECIATE YR INFO OF REFERENCE NUMBER FOR RETURN SHIPMENT.
REPORT ON REJECTED C.R.T

FROM SALES ORGANIZATION: NIHON PHILIPS CORPORATION

TYPE NO : D13-500GH/01
INDENTER : IWATSU CO., LIMITED
INVOICE NO. : 540/0261.02
INVOICE DATE : 19/12/75
DEFECTIVE QUANTITY : 2 PCS

TUBE NO. REASON FOR REJECTION
523392 FLAWS ON THE SCREEN
346289 FLAWS ON THE SCREEN AND FOUND TOO MANY BUBBLE

RGDS
SHIBANUMA NIHPHIL
161338
NNNN

Hr. v. Kemenade,
geeft u retour nr ?

N.V. Philips' Gloeilampfabrieken
Centrale Telegraaf- en Telexafdeling

2822 100 88051

Nihon Philips Corporation

Tokyo
Japan

*Kopie H.H. Wassenaar
Roodstake
Schell
v. Kemmerde*



PHILIPS

N.V. Philips' Gloeilampenfabrieken
Eindhoven, The Netherlands

P. O. Box 13, World Trade Center
Hamamatsu-cho, Minato-ku, Tokyo.

Attn: Mr. Modderman/ Elcoma BF

our ref **KT/mt/057/4**
057/

subject

Tel. Tokyo (03) 435-5211
Osaka (06) 231-7871

date **22 December, 1975**

Re : Report on Rejected C.R.T for W-210, W-211(1) (2)

→ see work folder

Dear Mr. Modderman,

We will enclose here the report on Rejected C.R.T. questionnaire W-210, W-211 for 19 pcs which we would like to have your investigation on the tube.

We will highly appreciate your information of reference number for return shipment.

With best regards,

Yours faithfully,

p.o. NIHON PHILIPS CORPORATION

K. Taniguchi

K. Taniguchi

Elcoma Div.

Enclosure

cc: Mr. VD Poel/ Elcoma BA04.

9694-55293-HVV-7219-409

REPORT ON REJECTED C.R.T.

Questionnaire No.W-210

From Sales Organization: Nihon Philips Corporation
Type No. : D13-500GH/01
Indenter : Iwatsu Co., Limited
Order No. : 440-143
Invoice No. : 540/0216.01
Invoice Date. : 28/10/75
Defective Quantity : 1 pce

Tube No.

Reason for Rejection



524513

Bubble massed together whole
part of the screen.

REPORT ON REJECTED C.R.T.

Questionnaire No. W-211 (1)

From Sales Organization : Nihon Philips Corporation
Type No. : D13-500GH/01
Indenter : Iwatsu Co., Limited
Order No. : 440-143
Invoice No. : 540/0216.01
Invoice Date. : 28/10/75
Defective Quantity : 17 pcs
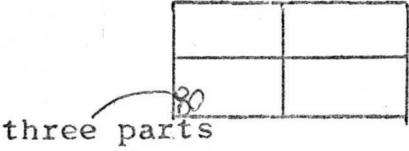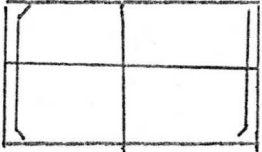
<u>Tube No.</u>	<u>Reason for Rejection</u>
(1) 524485, 524486, 523380, 523378, 518946, 514971, 518969, 522913, 522920, 524499, 524500, 524492, 524487, 523376, 524516,	Bubble massed tother on the screen
(2) 522768 	Big dust on the lower left of the screen (bright line is distorted extremely)
(3) 522767 	Bright line is distorted on both upper and lower part of left side screen, and on the the lower part of right side screen. (this bending is over up by brightness baries)

REPORT ON REJECTED C.R.T.

J. O. Inc. 10 100's Trade Dress
100 100's Trade Dress

Questionnaire No. W-211 (2)

From Sales Organization : Nihon Philips Corporation
Type No. : D13-500GH/01
Indenter : Iwatsu Co., Limited
Invoice No. : 540/0171.02
Invoice Date : 02/09/75
Order No. : 440-143
Defective Quantity : 1 pce

Tube No

Reason for rejection

514995

There is a flow (7mm) on the left
upper part of the flourecent
membrane